

SHERIDAN SCHOOL

Broadway, University Ave. and Fourth St. N.E.

1933

Mr. E. A. Mooney, Principal

| | |
|-------------------------|------|
| Originally Erected | 1932 |
| Number of Class Rooms | 30 |
| Number of Special Rooms | 6 |
| Enrollment | 1300 |

SHERIDAN SCHOOL

This is a new school building combining grade and junior high school work.

DETAILED REPORT

OCCUPANCY: Basement, heating plant, community room and kitchen, pump room, store room. First floor, teachers' lunch room, domestic science room, manual training, metal working, electrical shop, printing, gymnasium. Second floor, class rooms, general science, sewing room. Third floor, sub-normal manual training room, class rooms.

CARE AND MAINTENANCE: Building new and in good repair. Well maintained.

EGRESS FACILITIES: Good. Four easily accessible stairways with adequate number of exit doors. Gymnasium used for assembly purposes, exit lights provided, adequate exit facilities. Panic bars where needed.

COMMON HAZARDS: LIGHT--Electric, with wiring in conduit, commercial service, good installation. HEAT -- Three low pressure steam boilers in fireproof basement room communicating with remainder of building through metal clad automatic closing doors not labeled. VENTILATION -- Metal vent duct carried to ventilating chambers in attic, all vent chambers discharge outside.

SPECIAL HAZARDS: The hazards consisting of vocational training are confined largely to the rear section of the first floor; training consisting of wood and metal working, an electrical shop, a print shop with domestic science for the girls. All gas heated devices have permanent connections with shut off ahead of each device. Gas plates on metal and asbestos protected tables, bunsen burners where used have shut off at solid end only. Metal under presses in print shop. Benzine limited to one quart kept in approved can. Pilot lights for all electric heated devices.

EXPOSURES: None.

FIRST AID PROTECTION: Four standpipe and hose outlets on each floor except basement where there are two. Approved type fire extinguishers located near each standpipe outlet. Extinguisher equipment inadequate but of value. Standpipe and hose covers building adequately. All equipment well maintained and well placed.


PUBLIC PROTECTION: Full city protection. Adequate number of hydrants nearby. Five blocks to fire station, one block to fire alarm box.

RECOMMENDATIONS

1. Install adequate number of fire extinguishers.
2. Replace temporary wood platform under oil barrels in unfinished basement with concrete slab.

SHERIDAN SCHOOL

Scale: 1"=50'

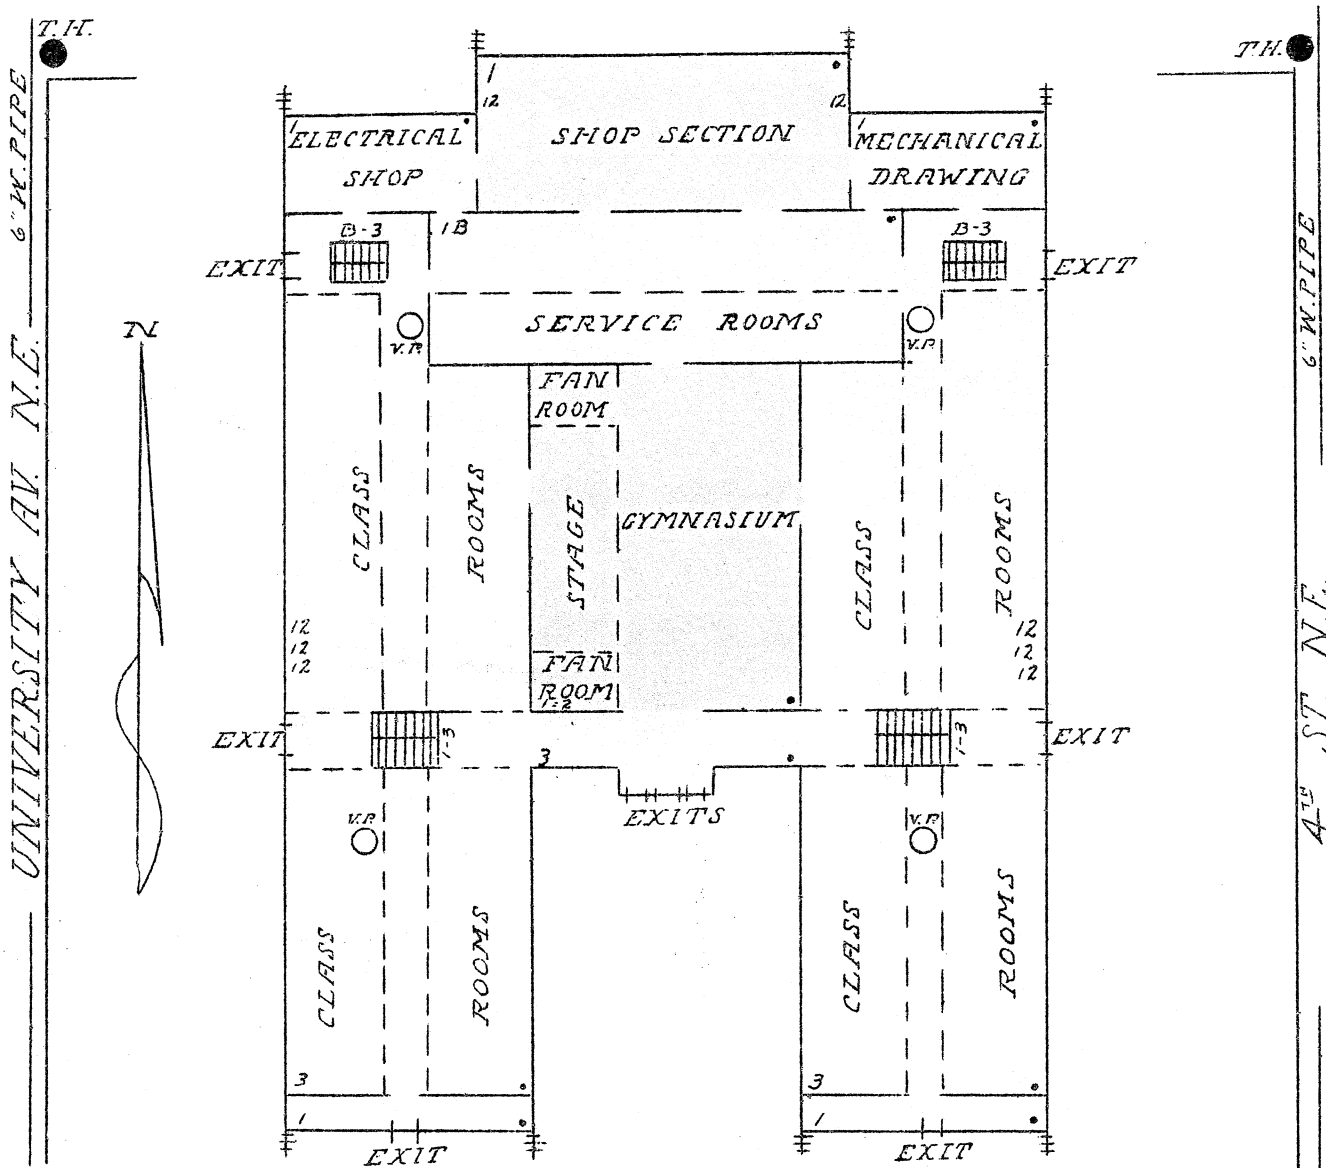

ERECTED: 1932.
 CONDITION: Good.
 HEIGHT: 1, 2 and 3 stories with part basement.
 AREA: Basement, 5000 sq. ft.; 1st 47,400 sq. ft.;
 2nd and 3rd, 28,700 sq. ft.
 WALLS: 12" brick, panel construction.
 FLOORS: Reinforced concrete joist and slab, wood surfaced in class rooms.
 ROOF: False wood over concrete slab ceiling except over gymnasium and shop sections which have precast concrete tile on unprotected metal.
 FLOOR OPENINGS: 2 open stairways basement to 3rd, 2 open stairways 1st to 3rd.

T.H.

BROADWAY S.W.P.

T.H.

T.H.