

HAY SCHOOL

2112 OAK PARK AVENUE

1931

Miss N. M. Strate, Principal

Originally Erected	1906
Number of Class Rooms	18
Number of Special Rooms	0
Enrollment	712

## HAY SCHOOL

A two story brick structure with wood floors and roof, also a two story fireproof addition.

### DETAILED REPORT

OCCUPANCY: Book room, gymnasium, sub-normal room and community kitchen, basement. Class rooms, first and second.

CARE AND MAINTENANCE: Building in good repair. Premises neat and orderly.

EGRESS FACILITIES: Poor. Two wood stairways in old section, none in fireproof addition.

COMMON HAZARDS: LIGHT -- Electric, wiring in rigid conduit.

HEAT -- Steam from Lincoln Junior High School. VENTILATION -- All metal ducts carried through roof.

SPECIAL HAZARDS: None.

EXPOSURES: None.


FIRST AID PROTECTION: A deficient number of chemical fire extinguishers.

PUBLIC PROTECTION: Fair. Four double hydrants on six inch water main and one fire department within one mile, paved streets intervening.

### RECOMMENDATIONS

1. Install a sufficient number of approved 2½ gallon chemical fire extinguishers.
2. Replace wood stairways with those of fireproof construction.
3. Install a safe means of egress from new addition as a fire in the stairway adjoining this building would cut off all means of escape from the first and second floors.
4. Discontinue the storage rooms in the basement under wood stairways and either remove the partitions or close them up solidly.

LINCOLN JUNIOR HIGH SCHOOL

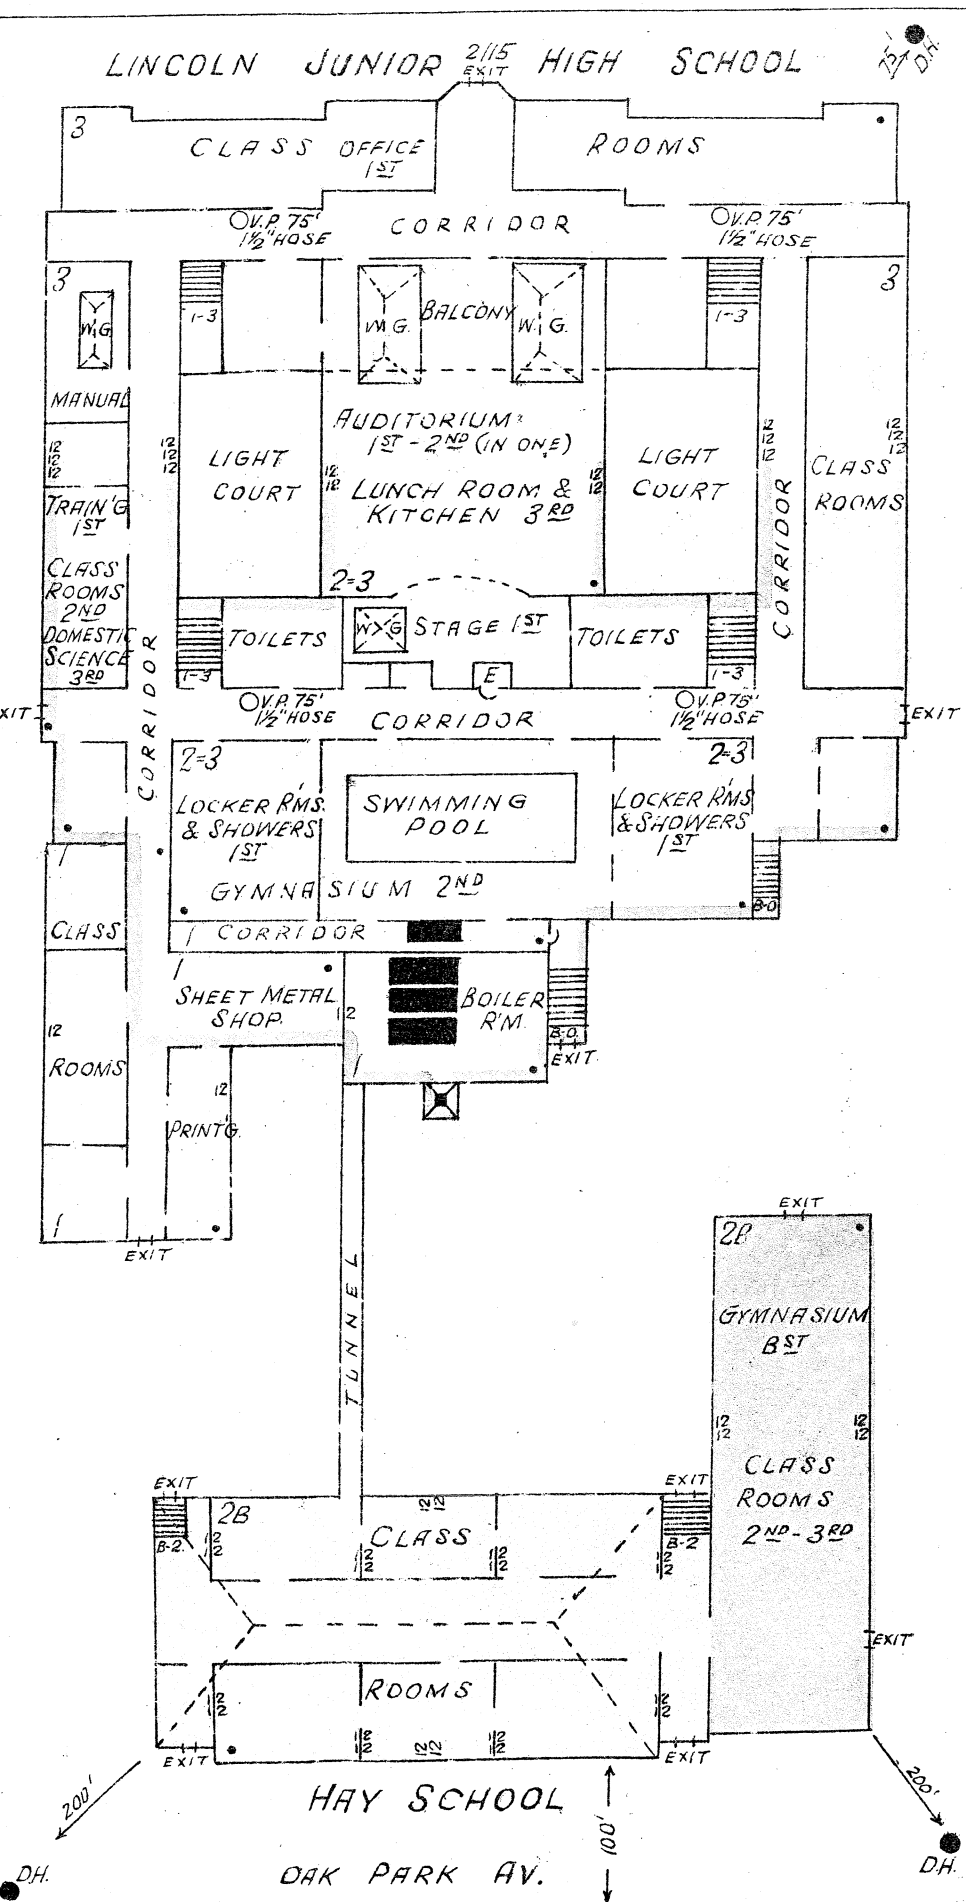

60'  
6" W.P.  
OLIVER AV. N.

**ERECTED:** 1906-1925.  
**CONDITION:** Good.  
**HEIGHT:** Two stories.  
**AREA:** 15,450 sq. ft. bsf., 1st and 2nd.  
**WALLS:** 12" brick.  
**FLOORS:** Wood in old section, reinforced concrete new section.  
**ROOF:** Slate on wood old section, false roof on new section.  
**FLOOR OPENINGS:** Two open wood stairways, but none in new addition.

**HAY SCHOOL**  
 MINNEAPOLIS, MINNESOTA  
 SCALE: 1 IN. = 50 FT.

D.H.

66  
E.W.P.

PENN AV. N.

